
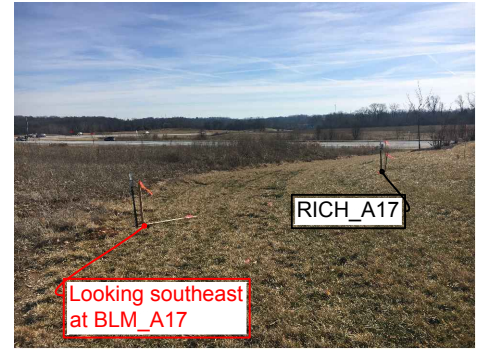


▲ Monument Description: 5/8" rebar found flush, added 2" Aluminum Berntsen cap stamped "MONROE CO SURVEYOR"

State Plane Grid Coordinates: Point No.:41 Northing: 1437420.1', Easting: 3097200.4'

SHEET 1 OF 2	MONUMENT RECORD CORNER ID: BLM_A17	Section Corner Section 19 & 30- T09N-R01W Bloomington Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

Photos were taken on 02/12/2018 with an iPhone 6s

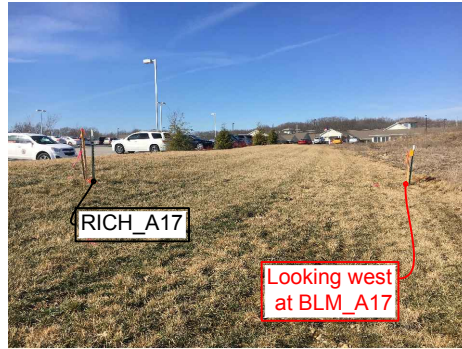

ORIGIN: This corner was calculated per the 2009 corner perpetuation survey by Eric Deckard (Monroe County Surveyor's Office, Flat Files, Richland Township Drawer). Mr. Deckard found a 5/8" rebar with Bynum Fanyo cap 1" below grade, which appears to have been destroyed by recent construction activity in the area.

HISTORY: A 1/2" rebar was set at this corner by the MSE Corporation per a drawing dated January 15, 1992, that is included with the current monument record for RICH_Y17. The MSE rebar was found and accepted by Ben Bledsoe in 1993 (Survey Book 2, page 400). It was witnessed by the Monroe County Surveyor on July 13, 2000, and accepted by the Monroe County Surveyor Review Board on December 14, 2000. In 2009, Deckard described the monument as a 5/8" rebar with Bynum Fanyo cap. In 2015, Curry (D/109, D/119 & D/147) described the monument as a rebar with cap. I'm not sure when the 1/2" MSE rebar was replaced with a Bynum Fanyo rebar, but the measured distance between the stone at RICH_A17 and this corner remained consistent. I did not research the full history of this monument because this corner was not necessary for the establishment of any corners in Section 24- T09N-R02W. It is shown hereon for reference and will be further evaluated when Sections 19 and 30 -T9N-R1W are perpetuated.

PERPETUATION: The theoretical location of this corner was accepted by the Monroe County Surveyor Review Board on November 21, 2017. Crider and Crider was responsible for the destruction of the rebar. They agreed to hire Bynum Fanyo, the firm that originally subdivided the property being developed by Crider and Crider, to set a Harrison Monument at this corner. Construction activity in this area is ongoing, so Bynum Fanyo set a temporary rebar, which this office capped and witnessed on February 12, 2018. A Harrison Monument will be set when construction in this area is complete.



Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on November 21, 2017



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
BLM_A17

Section Corner
Section 19 & 30- T09N-R01W
Bloomington Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 19 Township: 9N

Range: 1W

Corner ID: Blm A- 17



Monument Description & Remarks: ½" rebar. New State Road 46 construction. All trees are cut down east of the fence, blasting and grading work

References On File: Ben Bledsoe survey for Bob & Margaret Ellett property. Recorders survey book 2 page 400.

Field Book: 2000-01

Page No.: 73. See page 72.

USGS Quad: Bloomington

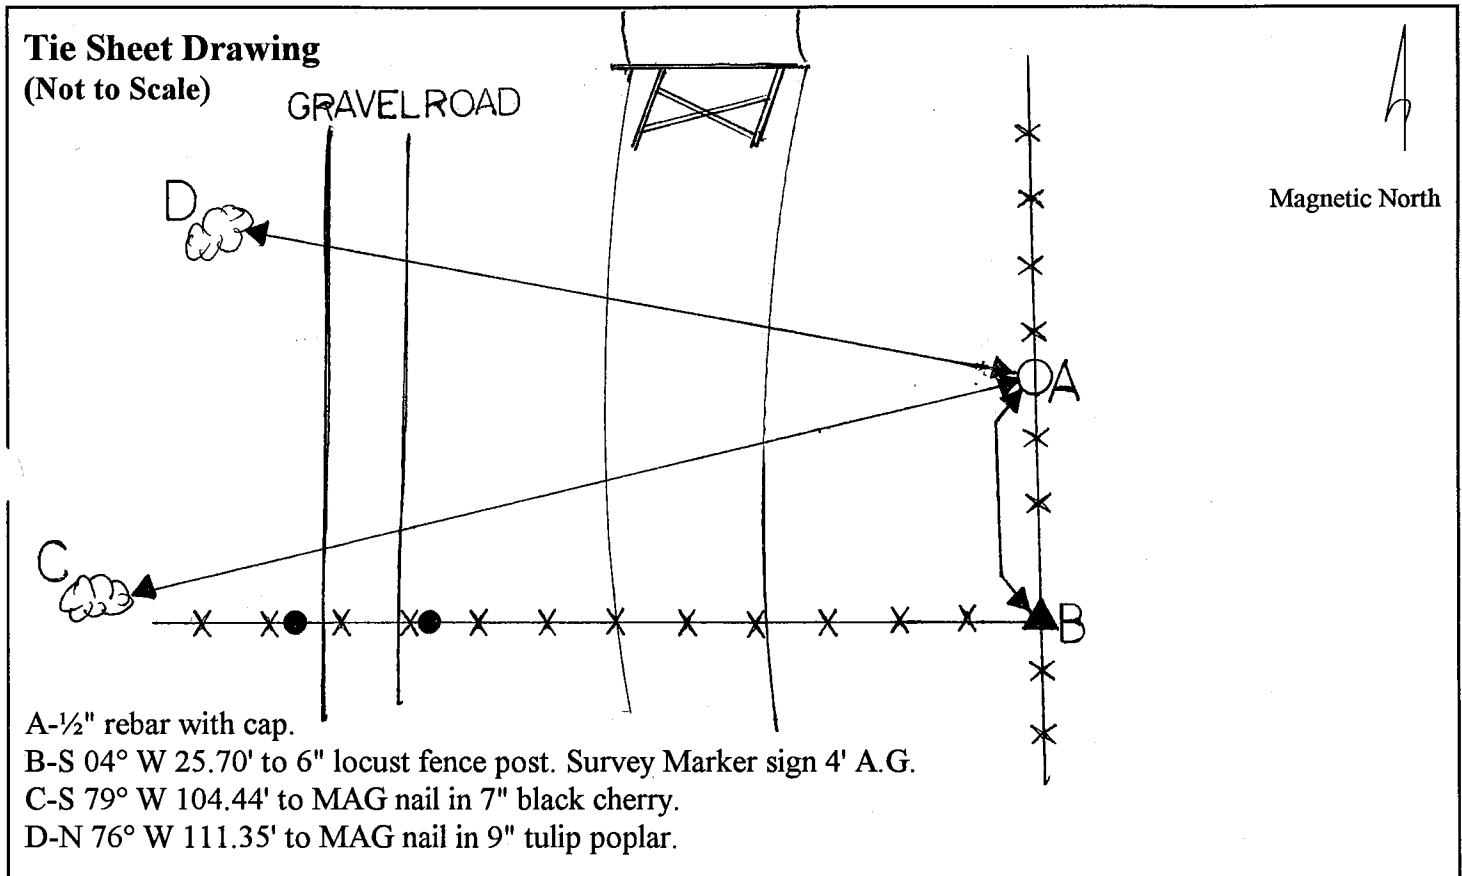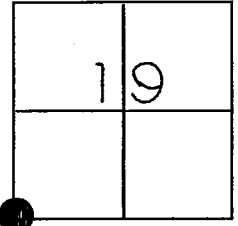

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand this 13th day of July, 2000.

Kevin P. Enright



Certified and sealed by the Monroe County Surveyor Review Board

Date: December 14, 2000



December 11, 2000